

Dave Morey
Vice President
Farley Project

Southern Nuclear
Operating Company
P.O. Box 1295
Birmingham, Alabama 35201
Tel 205.992.5131

September 28, 1998



Docket No.: 50-348

10 CFR 50.73

U. S. Nuclear Regulatory Commission
ATTN: Document Control Desk
Washington, DC 20555

Joseph M. Farley Nuclear Plant - Unit 1
Licensee Event Report No. 98-004-00
Reactor Protection System Card Failure Caused Turbine Trip
and Consequent Reactor Trip

Ladies and Gentlemen:

Joseph M. Farley Nuclear Plant - Unit 1 Licensee Event Report No. 98-004-00 is being submitted in accordance with 10 CFR 50.73(a)(2)(iv). There are no NRC commitments in the Licensee Event Report.

If you have any questions, please advise.

Respectfully submitted,

A handwritten signature in black ink, appearing to read "DM Morey".

Dave Morey

EWC/maf rxsyed.doc

Enclosure

cc: Mr. L. A. Reyes, Region II Administrator
Mr. J. I. Zimmerman, NRR Project Manager
Mr. T. P. Johnson, Plant Sr. Resident Inspector

IE22/1

9810070019 980928
PDR ADDCK 05000348
S PDR

LICENSEE EVENT REPORT (LER)

(See reverse for required number of digits/characters for each block)

APPROVED BY OMB NO. 3150-0104 EXPIRES 06/30/2001

Estimated burden per response to comply with this mandatory information collection request: 50 hrs. Reported lessons learned are incorporated into the licensing process and fed back to industry. Forward comments regarding burden estimate to the Records Management Branch (T-6 F33), U.S. Nuclear Regulatory Commission, Washington, DC 20555-0001, and to the Paperwork Reduction Project (3150-0104), Office of Management and Budget, Washington, DC 20503. If an information collection does not display a currently valid OMB control number, the NRC may not conduct or sponsor, and a person is not required to respond to, the information collection.

FACILITY NAME (1)

Joseph M. Farley Nuclear Plant- Unit 1

DOCKET NUMBER (2)

05000348

PAGE (3)

1 OF 3

TITLE (4)

Reactor Protection System Card Failure Caused Turbine Trip and Consequent Reactor Trip

EVENT DATE (5)			LER NUMBER (6)			REPORT DATE (7)			OTHER FACILITIES INVOLVED (8)	
MONTH	DAY	YEAR	YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	MONTH	DAY	YEAR	FACILITY NAME	DOCKET NUMBER
09	09	1998	1998	0 0 4	0	09	28	1998	FACILITY NAME	DOCKET NUMBER
OPERATING MODE (9)			THIS REPORT IS SUBMITTED PURSUANT TO THE REQUIREMENTS OF 10 CFR 8: (Check one or more) (11)							
1			20.2201(b)		20.2203(a)(2)(v)		50.73(a)(2)(i)		50.73(a)(2)(viii)	
POWER LEVEL (10)			20.2203(a)(1)		20.2203(a)(3)(i)		50.73(a)(2)(ii)		50.73(a)(2)(x)	
100			20.2203(a)(2)(ii)		20.2203(a)(3)(ii)		50.73(a)(2)(iii)		73.71	
			20.2203(a)(2)(ii)		20.2203(a)(4)		X 50.73(a)(2)(iv)		OTHER	
			20.2203(a)(2)(iii)		50.36(c)(1)		50.73(a)(2)(v)		Specify in Abstract below or in NRC Form 366A	
			20.2203(a)(2)(iv)		50.36(c)(2)		50.73(a)(2)(vii)			

LICENSEE CONTACT FOR THIS LER (12)

NAME

L.M. Stinson, General Manager- Nuclear Plant

TELEPHONE NUMBER (Include Area Code)

(334) 899-5156

COMPLETE ONE LINE FOR EACH COMPONENT FAILURE DESCRIBED IN THIS REPORT (13)

CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO EPIX	CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO EPIX
X	JC	RLY	W120	Y					

SUPPLEMENTAL REPORT EXPECTED (14)

YES (If yes, complete EXPECTED SUBMISSION DATE).	X NO	EXPECTED	MONTH	DAY	YEAR
---	------	----------	-------	-----	------

ABSTRACT

On September 9, 1998, while operating in Mode 1 at 100% power, the Unit 1 reactor automatically tripped due to a main turbine trip. Additionally, both steam generator feed pumps (SGFPs) automatically tripped and a main feedwater isolation occurred. The cause of the trip was failure of a circuit card in solid state protection system (SSPS) train B. Failure of this card resulted in a spurious hi-hi steam generator water level signal. This condition directly caused a main turbine trip, both SGFP trips, and a main feedwater isolation. The main turbine trip resulted in an automatic reactor trip. The specific failure mechanism for this card is under investigation by the supplier.

All other systems functioned as designed and plant response to the transient was as expected.

The failed card was replaced. Unit 1 returned to power operation on September 10, 1998.

LICENSEE EVENT REPORT (LER)
TEXT CONTINUATION

FACILITY NAME (1)	DOCKET (2)	LER NUMBER (6)				PAGE (3)
Joseph M. Farley Nuclear Plant Unit 1	05000348	YEAR	SEQUENTIAL NUMBER			REVISION NUMBER
		1998	--0	0	4--	00

TEXT (If more space is required, use additional copies of NRC Form 366A) (17)

Plant and System Identification

Westinghouse -- Pressurized Water Reactor

Energy Industry Identification System codes are identified in the text as [XX].

Description of Event

On September 9, 1998, while operating in Mode 1 at 100% power, the Unit 1 reactor automatically tripped due to a main turbine trip that resulted from a circuit card failure in the solid state protection system (SSPS). Additionally, a trip of both steam generator feed pumps (SGFPs) [SJ] and a main feedwater isolation resulted from the card failure. The plant responded as designed following the event. A root cause analysis was initiated. The cause of the card failure remains under investigation.

Cause of Event

The cause of the trip was failure of universal card A204 in SSPS [JC] train B. Failure of this card has the same effect as 2 out of 3 Steam Generator (SG) level detectors on 1A SG being above the hi-hi level actuation setpoint. This directly caused a main turbine trip, both SGFP trips, and a main feedwater isolation. Since power was above the P-8 interlock setpoint (35%), a reactor trip was directly initiated by the main turbine trip. The failure mechanism for this card is not yet known. The failed card has been shipped to the supplier for analysis. Based on the results of the analysis, additional action will be considered.

Safety Assessment

All safety systems operated as designed and plant response was as expected. The health and safety of the public were unaffected by this event.

This event would not have been more severe had it occurred under different operating conditions.

Corrective Action

The failed card was replaced and both trains of SSPS were tested satisfactorily.

LICENSEE EVENT REPORT (LER)
TEXT CONTINUATION

FACILITY NAME (1)	DOCKET (2)	LER NUMBER (6)			PAGE (3)			
		YEAR	SEQUENTIAL NUMBER		REVISION NUMBER			
Joseph M. Farley Nuclear Plant Unit 1	05000348	1998	--0	0	4--	00	3	OF 3

TEXT (If more space is required, use additional copies of NRC Form 366A) (17)

Additional Information

No similar LERs have been reported by Farley Nuclear Plant in the last two years.

A four hour non-emergency notification was made pursuant to 10CFR50.72.

CATEGORY 1

REGULATORY INFORMATION DISTRIBUTION SYSTEM (RIDS)

ACCESSION NBR:9810070019 DOC.DATE: 98/09/28 NOTARIZED: NO DOCKET #
FACIL:50-348 Joseph M. Farley Nuclear Plant, Unit 1, Southern Nucl 05000348
AUTH.NAME AUTHOR AFFILIATION
STINSON,L.M. Southern Nuclear Operating Co.
MOREY,D. Southern Nuclear Operating Co.
RECIP.NAME RECIPIENT AFFILIATION

SUBJECT: LER 98-004-00:on 980909,turbine trip & consequent reactor trip occurred.Caused by reactor protection sys card failure. Failed card was replaced & Unit 1 returned to power on 980910.With 980928 ltr.

DISTRIBUTION CODE: IE22T COPIES RECEIVED:LTR 1 ENCL 1 SIZE: 4
TITLE: 50.73/50.9 Licensee Event Report (LER), Incident Rpt, etc.

NOTES:

	RECIPIENT ID CODE/NAME	COPIES LTTR ENCL	RECIPIENT ID CODE/NAME	COPIES LTTR ENCL
	PD2-2 PD	1 1	ZIMMERMAN,J	1 1
INTERNAL:	ACRS	1 1	AEOD/SPD/RAB	2 2
	AEOD/SPD/RRAB	1 1	FILE CENTER	1 1
	NRR/DE/ECGB	1 1	NRR/DE/EELB	1 1
	NRR/DE/EMEB	1 1	NRR/DRCH/HICB	1 1
	NRR/DRCH/HOHB	1 1	NRR/DRCH/HQMB	1 1
	NRR/DRPM/PECB	1 1	NRR/DSSA/SPLB	1 1
	RES/DET/EIB	1 1	RGN2 FILE 01	1 1
EXTERNAL:	L ST LOBBY WARD	1 1	LITCO BRYCE,J H	1 1
	NOAC POORE,W.	1 1	NOAC QUEENER,DS	1 1
	NRC PDR	1 1	NUDOCS FULL TXT	1 1

NOTE TO ALL "RIDS" RECIPIENTS:

PLEASE HELP US TO REDUCE WASTE. TO HAVE YOUR NAME OR ORGANIZATION REMOVED FROM DISTRIBUTION LISTS OR REDUCE THE NUMBER OF COPIES RECEIVED BY YOU OR YOUR ORGANIZATION, CONTACT THE DOCUMENT CONTROL DESK (DCD) ON EXTENSION 415-2083

FULL TEXT CONVERSION REQUIRED

TOTAL NUMBER OF COPIES REQUIRED: LTTR 23 ENCL 23